







Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barr, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 Email: woodmanseyclerk@lawks.co.uk	327896	King Street, Woodmansey HU17 0TE	1 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Jill Climber - Yellow on Black Weipour	Wicksteed	L	Paint is wearing. Recommend this item is rubbed down and repainted. Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre. Recommend moss growth is removed from the weipour playing surface to reduce slip / trip hazards. Best method is to pressure wash with a mild detergent solution.					
RP 182 2.4m 1 Bay Swing 2 x Cradle Seats on Black Weipour	Record 1995	M	Movement evident in the swing frame. 1 fixing is protruding, and all fixings are corroded. Recommend all frame fixings are replaced. Both seats and chains were removed, and message was left on the customer's answerphone at the time of previous inspection August 2016. Recommend all frame fixings, and both cradle seats are replaced, using existing chains and shackles held in store by Wicksteed.			These works have been ordered, Wicksteed order No 331161		
Free Standing Slide on Black Weipour	Record		Satisfactory condition.					
Whale Spring Mobile - Blue on Black Weipour	Ledon	L	Monitor minor damage to 1 handrail for sharp edges etc.					
Elephant Spring Mobile - Yellow on Black Weipour	Ledon	L	Monitor minor corrosion on the spring.					
2.4m 1 Bay Swing 1 x Flat Seat on Black Weipour	Record	L	Monitor minor damage to the footrests and hand holds.					
			Recommend missing seat and chains are replaced to restore play value.	1 1 2 2	5001F113 4061-112 Hags Hags	Flat Rubber Safety Seat c/w Fixings Straight Link Chain for Flat Seats 109303 Shackle Assembly 15011812 Oilite Bush Delivery from Hags	£40.00 £44.00 £10.00 £4.25 £10.00	£40.00 £44.00 £20.00 £8.50 £10.00
<b>INDICATION OF RISK RATING ASSESSMENT</b>								
HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes								
Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		H/MH M V/L		INSPECTED BY :- AJ Hayes DATE :- 06. 02. 2017		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered	(E&O.E.)	£122.50 £0.00 £122.50 See sheet 3
 								

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barr, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 Email: woodmanseyclerk@lawks.co.uk	327896	King Street, Woodmansey HU17 0TE	2 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Storm Multiplay Unit with Curved Slide Chute on Black Wetpour	Wicksteed	M	Recommend the missing lower level climbing wall panel is replaced to reduce falling hazards to users. Fails BS EN 1176 Toggle Test at the top of the slide chute. (Ref BS EN 1176:2008 Part 1 Section 4.2.7.3) Recommend stainless steel slide top panel is drilled and bolted through the painted frame (2 positions) to prevent toggle entrapment hazards. This will require the yellow frame to be removed and refitted to allow access. Paint is wearing, in particular at access and climbing areas. Recommend affected areas are rubbed down and repainted. Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre. Missing fixing at the green barrier was replaced at the time of the inspection.	2 2 2	2176-128 2215-508 2177-007	This work has been ordered, Wicksteed order No 331161  M10 x 45 Pent Button Head Screw M10 Washer M10 Pentagon Safety Fastener	£1.79 £0.45 £2.00	£3.58 £0.90 £4.00
Agility Unit with Grey Posts on Black Wetpour	unknown	L	Monitor wear on the paintwork.	1	2176-126	M10 x 25 Pent Button Head Screw	FOC	
Free Standing Basketball Goal on Concrete	Parkdale PPL	L	Monitor cracks in the concrete surface for trip hazards.	1	2215-519	M10 Wicksteed Washer	FOC	
2 x Football goals on Grass	unknown	L	Generally satisfactory, but recommend grounds maintenance as required to reduce hazards at areas of ground erosion.					
Perforated Metal Seats	Record	L	Generally satisfactory, but 1 seat would benefit from rubbing down and repainting (corrosion)					
Litter Bins	unknown		Satisfactory condition.					
2 x Timber Seats	unknown		Satisfactory condition.			Continues on next sheet...		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- <b>A J Hayes</b> DATE :- <b>06. 02. 2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered	<b>£8.48</b> <b>£122.50</b> <b>£130.98</b> <b>See sheet 3</b>		

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barr, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 Email: woodmanseyclerk@lawks.co.uk	327896	King Street, Woodmansey HU17 0TE	3 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Metal Bow Top Fence	unknown		Satisfactory condition, but fails BS EN 1176 Head & Neck Probe Test, Ref BS EN 1176:2008 Part 1 Section 4.2.7.2. No action recommended at present.					
Pedestrian Gates	unknown	L	Generally satisfactory, but monitor for potential pinch hazards (minimum 12mm gap recommended, ref BS EN 1176:2008 Part 1, section 4.2.7.6) Recommend grounds maintenance as required to reduce trip hazards at areas of ground erosion, exposed concrete and metal ground strip.					
Vehicle Access Gate			Satisfactory condition but recommend this is kept locked when not in use to prevent access by unauthorised vehicles. It is not possible to secure the gate in the closed position. This may lead to younger children leaving the play area towards the road if not fully supervised.					
General		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces)					
		L	The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>		H/MMH M V/L/L	<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>A J Hayes</b> DATE :- <b>06. 02. 2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT			<b>£0.00</b> <b>£130.98</b> <b>£130.98</b> <b>£320.00</b> <b>£450.98</b>
						