








Certified Inspection Report for:		Contact:	Order No: 327896	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barr, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 Email: woodmanseyclerk@lawks.co.uk		Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	1 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Roundabout on Black Wetpour	Record		Satisfactory condition. Bearings were greased at the time of inspection.					
1.8m 2 Bay Swing 3 x Cradle Seats on Black Wetpour	Record		Satisfactory condition.					
Car Spring Mobile on Blue / Black Wetpour	Record	L	Monitor minor damage to the seat back rest.					
Multiplay Unit on Black Wetpour	Record	L	Recommend missing fixing at yellow vertical rail is replaced. Inspector was unable to tighten the protruding bolt on the underside of the platform at the time of inspection. Paint is wearing at access and climbing areas. Recommend affected areas are rubbed down and repainted. Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre, or £92.50 per 5 litre tin.					
2.4m 1 Bay Swing	Record	L	Monitor minor damage to the seats.					
2 x Flat Seats on Black Wetpour	Record	L	Monitor split in 1 corner of the wetpour playing surface for trip hazards.					
2 x Talking Tubes	Record	L	Monitor minor damage. No hazards appear to be created at present.					
		L	Recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion.					
		L	Monitor security of ground fixing. Slight movement evident at time of inspection.					
			Continues on next sheet...					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			INDICATION OF RISK RATING ASSESSMENT	INSPECTED BY :- AJ Hayes DATE :- 06. 02. 2017	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered	(E&O.E.)	£0.00 £0.00 £0.00	See sheet 3

Certified Inspection Report for:		Contact:	Order No: 327896	Site Address:	SHEET				
Woodmansey Parish Council Juniper Cottages, 1 Manor Barr, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 Email: woodmanseyclerk@lawks.co.uk		Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	2 of 3				
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Spring See-Saw on Black Weipour	Ledon	L	Generally satisfactory, but foot rests fail BS EN 1176 Ring Gauge Test at 1 end (Ref BS EN 1176:2008 Part 6 Section 4.7) No remedial action is recommended at present. Foot rests at the other end have recently been replaced.						
Rotaweb Climber on Black Weipour	Tayplay	L	Fails BS EN 1176 Ground Clearance. Minimum 400mm recommended, approximately 380mm actual below the outer ring (Ref BS EN 1176:2008 Part 5 Section 5.5.4) No remedial action is recommended at present. Monitor area of damage to the rope sections for exposed metal strands which may create hazards to users.						
Perforated Metal Seats on Grass	Record	L	Satisfactory condition, but recommend nettle growth is cut back as required to allow safe access to the seats.						
Litter Bin	unknown		Satisfactory condition.						
Metal Bow Top Fence	unknown		Satisfactory condition.						
Single Leaf Gate		L	Recommend missing gate is replaced.						
Double Gates	unknown	MH	1 gate is missing. The other gate is not securely fitted, and may fall. Recommend gates are replaced or repaired as soon as possible.			This work has been ordered, Wicksteed order Nos 331160 and 331161			
General		M	Recommend extensive nettle growth throughout the area is removed, and monitored regularly to ensure safe use of the area, in particular for younger children.						
		M	Recommend holes in the grass areas are filled to reduce trip hazards.						
		M	Recommend bird faeces and rabbit droppings are removed as required to reduce health hazards to users, in particular to younger children.						
						Continues on next sheet...			
 			Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY :- A J Hayes DATE :- 06. 02. 2017	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered	£0.00 £0.00 £0.00	See sheet 3

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 Email: woodmanseyclerk@lawks.co.uk	327896	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	3 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
General (continued)		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces)					
		L	The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
<u>Outside Fenced Area</u> Informal BMX Track		M	Recommend holes in the grass area are filled, and remove tree branches, concrete blocks etc to allow safe use of this area.					
Multi Sports Goal on Tarmac	Parkdale PPL	L	Recommend damaged edges of the Tarmac surface are repaired to reduce trip hazards.					
Litter Bin	unknown		Satisfactory condition.					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- A J Hayes DATE :- 06. 02. 2017				
						PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT		£0.00 £0.00 £0.00 £0.00

A variety of signs are available
from Wicksteed Sales Dept