






Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332208	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	1 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Roundabout on Black Wetpour	Record		Satisfactory condition, but the item is stiff to rotate. Bearings were greased at the time of inspection.					
RP 163 1.8m 2 Bay Swing 3 x Cradle Seats on Black Wetpour	Record 2008	L	Monitor minor damage to the crotch strap on the orange seat.					
Car Spring Mobile on Blue / Black Wetpour	Record	L	Monitor minor damage to the seat back rest.					
		L	Monitor gaps at the edges of the wetpour playing surface for trip hazards. Some edges have been repaired previously.					
		L	Recommend nettle growth at the grass area next to the item is removed as required.					
Multiplay Unit on Black Wetpour	Record	M	Recommend the loose / damaged bottom timber log on the access ramp is replaced.	1	B610SPEC	305312 Log	£35.00	£35.00
		L	Inspector was unable to tighten the protruding bolt on the underside of the platform at the time of inspection. The platform is secure, and no hazards are created.	2	B610SPEC	10121030 M10 x 30 Torx and Pin	£1.75	£3.50
		L	Paint is wearing at access and climbing areas. Recommend affected areas are rubbed down and repainted.	2	B610SPEC	10291000 M10 Washer	£0.81	£1.62
		L	Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre, or £92.50 per 5 litre tin.	2	B610SPEC	10941000 M10 T-Nut	£1.01	£2.02
		L	Monitor impact damage to the slide chute.			409118 Black Plastic Bung Delivery from Hags SMP	£0.62	£1.24
		L	Monitor minor damage to the seats.			<b>Labour to replace the log*</b> (This is based on the work being ordered at the same time as the work at King Street)	£10.00	£10.00
2.4m 1 Bay Swing 2 x Flat Seats on Black Wetpour	Record	L	Monitor split in 1 corner of the wetpour playing surface for trip hazards.					
		L	The loose seat to chain eye bolt fixings were tightened at the time of the inspection.					
Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028		H/MH M V/L	<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>A J Hayes</b> DATE :- <b>09. 11. 2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered	(E&O.E.)		<b>£53.38</b> <b>£0.00</b> <b>£53.38</b> <b>See sheet 3</b>



Certified Inspection Report for:			Contact:	Order No: 332208	Site Address:	SHEET		
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX			Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk		Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	2 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
2 x Talking Tubes	Record	L	Monitor minor damage. No hazards appear to be created at present. Recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion. Monitor security of ground fixing. Slight movement evident at the time of the inspection.					
Rotaweb Climber on Black Wetpour	Tayplay	L	Falls BS EN 1176 Ground Clearance. Minimum 400mm recommended, approximately 380mm actual below the outer ring (Ref BS EN 1176:2008 Part 5 Section 5.5.4) No remedial action is recommended at present. Monitor area of damage to the rope sections for exposed metal strands which may create hazards to users.					
Spring See-Saw on Black Wetpour	Ledon	L	Generally satisfactory, but foot rests fail BS EN 1176 Ring Gauge Test at 1 end (Ref BS EN 1176:2008 Part 6 Section 4.7) No remedial action is recommended at present. Foot rests at the other end have recently been replaced.					
Perforated Metal Seats on Grass	Record	L	Monitor security of the ground fixing of the seat near to the cradle seat swing. Recommend grounds maintenance as required to reduce slip / trip hazards at areas of mud and ground erosion.					
Litter Bin	Broxap		Satisfactory condition.					
Metal Bow Top Fence	unknown		Satisfactory condition.					
Single Leaf Gate	Wicksteed 2017	L	Generally satisfactory, but recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion and exposed concrete. The gate is not self-closing.			Continues on next sheet...		
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b>	INSPECTED BY :- <b>A J Hayes</b> DATE :- <b>09. 11. 2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered	(E&O.E.)	<b>£0.00</b> <b>£53.38</b> <b>£53.38</b> <b>See sheet 3</b>	

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332208	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	3 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
<b>Double Gates</b>	<b>Wicksteed 2017</b>		Satisfactory condition. Not self-closing. The gates were open at the time of the inspection.					
<b>General</b>		<b>M</b>	Recommend the fungus growth at the grass area between the red spring mobile and the fence is removed, as this may be toxic. Refer to a specialist for advice as required. All play equipment and surfaces would benefit from cleaning. The best method is to pressure wash with a mild detergent solution.					
		<b>L</b>	The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
		<b>M</b>	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces)					
		<b>L</b>	The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
		<b>M</b>	Recommend holes in the grass area are filled as required to allow safe use of this area.					
<b>Outside Fenced Area</b>								
<b>Informal BMX Track</b>	unknown	<b>M</b>	Recommend holes in the grass area are filled as required to allow safe use of this area.					
<b>Multi Sports Goal on Tarmac</b>	Parkdale PPL		Satisfactory condition.					
<b>Litter Bin</b>	Wybone 2014		Satisfactory condition.					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>		H/MH M V/L	<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>A J Hayes</b> DATE :- <b>09. 11. 2017</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC VAT			<b>£0.00</b> <b>£53.38</b> <b>£53.38</b> <b>£180.00</b> <b>£233.38</b>
						 <p>A variety of signs are available from Wicksteed Sales Dept</p>		