






Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332207	King Street, Woodmansey HU17 0TE	1 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Jill Climber - Yellow on Black Wetpour	Wicksteed	L	Paint is wearing. Recommend this item is rubbed down and repainted. Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre.					
RP 182 2.4m 1 Bay Swing 2 x Cradle Seats on Black Wetpour	Record 1995	L	Recommend bird faeces on the seats are removed to reduce health hazards to users.					
Free Standing Slide on Black Wetpour	Record	L	Monitor gaps at the edge of the wetpour playing surface for trip hazards.					
Whale Spring Mobile - Blue on Black Wetpour	Ledon	L	Monitor minor damage to the handrail for sharp edges etc.					
Elephant Spring Mobile - Yellow Model 414 on Black Wetpour	Ledon 2007	L	Monitor minor corrosion on the spring.					
2.4m 1 Bay Swing 2 x Flat Seats on Black Wetpour	Record	L	Monitor minor damage to the footrests and hand holds. Satisfactory condition.					
Storm Multiplay Unit with Curved Slide Chute on Black Wetpour	Wicksteed	L	Paint is wearing, in particular at access and climbing areas. Recommend affected areas are rubbed down and repainted. Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre. 1 damaged plastic post cap was replaced at the time of the inspection.					
			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY: - A J Hayes DATE: - 11.08.2017		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00
 			Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028					
Continues on next sheet...								

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332207	King Street, Woodmansey HU17 0TE	2 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Agility Unit with Grey Posts on Black Wetpour	unknown	M L L	Recommend bird faeces on the orange discs are removed to reduce health hazards to users. Monitor wear on the paintwork. Fails BS EN 1176 Head & Torso Probe Test at 1 opening in the blue frame (Ref BS EN 1176:2008 Part 1 Section 4.2.7.2) No remedial action is feasible at present.					
Free Standing Basketball Goal on Concrete	Parkdale PPL	L	Monitor cracks in the concrete surface for trip hazards.					
2 x Football goals on Grass	unknown	L	Generally satisfactory, but recommend grounds maintenance as required to reduce hazards at areas of ground erosion.					
Perforated Metal Seats	Record	L	Generally satisfactory, but the seat near the unit with silver posts would benefit from rubbing down and repainting (corrosion)					
Litter Bins	unknown		Satisfactory condition.					
2 x Timber Seats	unknown	L	Generally satisfactory, but the raised edges of the concrete slabs may create trip hazards. Recommend grounds maintenance as required.					
Metal Bow Top Fence	unknown		Satisfactory condition, but fails BS EN 1176 Head & Neck Probe Test. Ref BS EN 1176:2008 Part 1 Section 4.2.7.2. No action recommended at present.					
			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY: - A J Hayes DATE: - 11.08.2017	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered			£0.00 £0.00 £0.00
			Continues on next sheet...					See sheet 3



Wicksteed Leisure Ltd
Digby St., Kettering
Northants, NN16 8YJ
Tel: 01536 517 028

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332207	King Street, Woodmansey HU17 0TE	3 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Pedestrian Gates	unknown	L	Generally satisfactory, but monitor for potential pinch hazards (minimum 12mm gap recommended, ref BS EN 1176:2008 Part 1, section 4.2.7.6) Recommend grounds maintenance as required to reduce trip hazards at areas of ground erosion, exposed concrete and metal ground strip.					
Vehicle Access Gate	unknown	M	Satisfactory condition (Locked at the time of inspection) Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces) Recommend moss growth is removed from the wetpour playing surfaces to reduce slip / trip hazards. Best method is to pressure wash with a mild detergent solution. The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
General		L						
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk		INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY: - A J Hayes DATE: - 11.08.2017		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC. VAT		£0.00 £0.00 £0.00 £0.00
 Anthony James Hayes-1059A ANNUAL INSPECTOR OUTDOOR 2017								

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332207	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	1 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Roundabout on Black Wetpour	Record		Satisfactory condition. Bearings were greased at the time of inspection.					
RP 163 1.8m 2 Bay Swing 3 x Cradle Seats on Black Wetpour	Record 2008	M L	Recommend bird faeces on the seats and the playing surface are removed to reduce health hazards to users. Monitor minor damage to the crotch strap on the orange seat.					
Car Spring Mobile on Blue / Black Wetpour	Record	L	Monitor minor damage to the seat back rest.					
Multiplay Unit on Black Wetpour	Record	L	Inspector was unable to tighten the protruding bolt on the underside of the platform at the time of inspection. Paint is wearing at access and climbing areas. Recommend affected areas are rubbed down and repainted. Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre, or £92.50 per 5 litre tin. Monitor impact damage to the slide chute.					
2.4m 1 Bay Swing	Record	L	Recommend bird faeces on the seats and the playing surface are removed to reduce health hazards to users.					
2 x Fiat Seats on Black Wetpour	Record	L	Monitor minor damage to the seats. Monitor split in 1 corner of the wetpour playing surface for trip hazards.					
2 x Talking Tubes	Record	L	Monitor minor damage. No hazards appear to be created at present. Recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion. Monitor security of ground fixing. Slight movement evident at the time of inspection.					
			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY: - A J Hayes DATE: - 11.08.2017		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered		£0.00 £0.00 £0.00 See sheet 3

Continues on next sheet...



Wicksteed Leisure Ltd
Digby St., Kettering
Northants, NN16 8YJ
Tel: 01536 517 028

Certified Inspection Report for:		Contact:	Order No:	332207	Site Address:	SHEET		
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk			Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	2 of 3		
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Rotaweb Climber on Black Wetpour	Tayplay	L	Fails BS EN 1176 Ground Clearance. Minimum 400mm recommended, approximately 380mm actual below the outer ring (Ref BS EN 1176:2008 Part 5 Section 5.5.4) No remedial action is recommended at present. Monitor area of damage to the rope sections for exposed metal strands which may create hazards to users.					
Spring See-Saw on Black Wetpour	Ledon	L	Generally satisfactory, but foot rests fail BS EN 1176 Ring Gauge Test at 1 end (Ref BS EN 1176:2008 Part 6 Section 4.7) No remedial action is recommended at present. Foot rests at the other end have recently been replaced.					
Perforated Metal Seats on Grass	Record	L	Monitor security of the ground fixing of the seat near to the cradle seat swing.					
Litter Bin	Broxap		Satisfactory condition.					
Metal Bow Top Fence	unknown		Satisfactory condition.					
Single Leaf Gate	Wicksteed 2017		Generally satisfactory, but recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion. The gate is not self-closing.					
Double Gates	Wicksteed 2017		Satisfactory condition. Not self-closing. The gates were open at the time of the inspection. There is no socket in the ground to enable the ground pins to be locked. This is creating grooves in the grass area.					
General		M	Recommend bird faeces and rabbit droppings are removed as required to reduce health hazards to users, in particular to younger children.					
			INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY: - A J Hayes DATE: - 11. 08. 2017	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered			£0.00 £0.00 £0.00 See sheet 3

Continues on next sheet...



Wicksteed Leisure Ltd
Digby St., Kethering
Northants, NN16 8YJ
Tel: 01536 517 028

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332207	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	3 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
General (continued)		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces) The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)			A variety of signs are available from Wicksteed Sales Dept		
Outside Fenced Area Informal BMX Track		M	Recommend holes in the grass area are filled as required to allow safe use of this area.					
Multi Sports Goal on Tarmac			Satisfactory condition.					
Litter Bin			Satisfactory condition, but recommend the nettle growth is cut back as required.					
Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 www.wicksteed.co.uk		H/MH M V/L/L	INDICATION OF RISK RATING ASSESSMENT HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- A J Hayes DATE :- 11. 08. 2017	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC. VAT			£0.00 £0.00 £0.00 £0.00

