












Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET				
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332209	King Street, Woodmansey HU17 0TE	1 of 3				
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Jill Climber - Yellow on Black Wetpour	Wicksteed	L	Paint is wearing. Recommend this item is rubbed down and repainted. Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre.						
RP 182 2.4m 1 Bay Swing 2 x Cradle Seats on Black Wetpour	Record 1995	L	Generally satisfactory, but the swing frame would benefit from repainting (red)						
Free Standing Slide on Black Wetpour	Record	L	Monitor gaps at the edge of the wetpour playing surface for trip hazards.						
Whale Spring Mobile - Blue on Black Wetpour	Ledon	L	The damaged plastic cover at the base of the spring was cable tied together at the time of the inspection, to prevent movement or unauthorised removal. This will be checked at each quarterly inspection in future.						
Elephant Spring Mobile - Yellow Model 414 on Black Wetpour	Ledon 2007	L	Monitor minor damage to the handrail for sharp edges etc. Monitor minor corrosion on the spring.						
2.4m 1 Bay Swing 2 x Flat Seats on Black Wetpour	Record	L	Monitor minor damage to the footrests and hand holds.						
Storm Multipley Unit with Curved Slide Chute on Black Wetpour	Wicksteed	L	Monitor wear and dips in the red wetpour playing surface below the seats.						
 			<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY: - <b>A J Hayes</b> DATE: - <b>14. 02. 2018</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered		<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>See sheet 3</b>
Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028									




Continues on next sheet...

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332209	King Street, Woodmansey HU17 0TE	2 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Agility Unit with Grey Posts on Black Wetpour	unknown	L	Monitor wear on the paintwork. Fails BS EN 1176 Head & Torso Probe Test at 1 opening in the blue frame (Ref BS EN 1176:2008 Part 1 Section 4.2.7.2) No remedial action is feasible at present.					
Free Standing Basketball Goal on Concrete	Parkdale PPL	L	Monitor cracks in the concrete surface for trip hazards.					
2 x Football goals on Grass	unknown	L	Generally satisfactory, but recommend grounds maintenance as required to reduce hazards at areas of ground erosion.					
Perforated Metal Seats	Record	L	Generally satisfactory, but the seat near the unit with silver posts would benefit from rubbing down and repainting (corrosion)					
Litter Bins	unknown		Satisfactory condition.					
2 x Timber Seats	unknown	L	Generally satisfactory, but the raised edges of the concrete slabs may create trip hazards. Recommend grounds maintenance as required.					
Metal Bow Top Fence	unknown		Satisfactory condition, but fails BS EN 1176 Head & Neck Probe Test. Ref BS EN 1176:2008 Part 1 Section 4.2.7.2. No action recommended at present.					
Pedestrian Gates	unknown	L	Generally satisfactory, but monitor for potential pinch hazards (minimum 12mm gap recommended, ref BS EN 1176:2008 Part 1, section 4.2.7.6) Recommend grounds maintenance as required to reduce trip hazards at areas of ground erosion, exposed concrete and metal ground strips.					
			<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY: - <b>A J Hayes</b> DATE: - <b>14.02.2018</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered		<b>£0.00</b> <b>£0.00</b> <b>£0.00</b>
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028			Continues on next sheet...				<b>See sheet 3</b>	

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332209	King Street, Woodmansey HU17 0TE	3 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Vehicle Access Gate		unknown	Satisfactory condition (Locked at the time of the inspection)					
General		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces. (Litter (animal droppings) order 1991of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces) Recommend moss growth is removed from the wetpour playing surfaces to reduce slip / trip hazards. Best method is to pressure wash with a mild detergent solution. The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
		L	Long grass may create slip / trip hazards, and may conceal hazards such as broken glass, animal faeces etc. Recommend the grass is cut as required.					
		L						
  <p>Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a></p>		H/MH M V/L/L	<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes	INSPECTED BY :- <b>A J Hayes</b> DATE :- <b>14. 02. 2018</b>	 <p>Anthony James Hayes - 10594 ANNUAL INSPECTOR OUTDOOR 2018</p>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC. VAT	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET				
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332209	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	1 of 3				
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
Roundabout on Black Wetpour	Record		Satisfactory condition, but the item is stiff to rotate. Bearings were greased at the time of inspection.						
RP 163 1.8m 2 Bay Swing 3 x Cradle Seats on Black Wetpour	Record 2008	L	Monitor minor damage to the crotch strap on the orange seat.						
Car Spring Mobile on Blue / Black Wetpour	Record	L	Monitor minor damage to the seat back rest.						
		L	Monitor gaps at the edges of the wetpour playing surface for trip hazards. Some edges have been repaired previously. Recommend nettle growth at the grass area next to the item is removed as required.						
Multiplay Unit on Black Wetpour	Record	L	Monitor minor damage around the fixing holes on the purple ramp panel for sharp edge hazards. Costs to replace the panel are available on request.						
		L	Paint is wearing at the access and climbing areas. Recommend the affected areas are rubbed down and repainted.						
		L	Note that BS EN 1176:2008 states that paint shall be non-toxic. Suitable paint (primer and top coat) is available from Wicksteed Sales Dept at a cost of £20 per litre, or £92.50 per 5 litre tin.						
		L	Monitor impact damage to the slide chute.						
		L	Inspector was unable to tighten the protruding bolt on the underside of the platform at the time of the inspection. The platform is secure, and no hazards are created.						
2.4m 1 Bay Swing 2 x Flat Seats on Black Wetpour	Record	L	Monitor minor damage to the seats.						
		L	Monitor split in 1 corner of the wetpour playing surface for trip hazards.						
 		Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028	HM/MH M V/L/L	<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY: - <b>A J Hayes</b> DATE: - <b>14.02.2018</b>	PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered	<b>£0.00</b> <b>£0.00</b> <b>£0.00</b>	<b>See sheet 3</b>
						Continues on next sheet...			

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET				
Woodmansey Parish Council Juniper Cottages, 1 Manor Barrn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332209	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	2 of 3				
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL	
2 x Talking Tubes	Record	L	Monitor minor damage. No hazards appear to be created at present. L Recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion. L Monitor security of ground fixing. Slight movement evident at the time of the inspection.						
Rotaweb Climber on Black Wetpour	Tayplay	L	Falls BS EN 1176 Ground Clearance. Minimum 400mm recommended, approximately 380mm actual below the outer ring (Ref BS EN 1176:2008 Part 5 Section 5.5.4) No remedial action is recommended at present. L Monitor area of damage to the rope sections for exposed metal strands which may create hazards to users.						
Spring See-Saw on Black Wetpour	Ledon	L	Generally satisfactory, but the foot rests fall BS EN 1176 Ring Gauge Test at 1 end (Ref BS EN 1176:2008 Part 6 Section 4.7). No remedial action is recommended at present. Foot rests at the other end have recently been replaced.						
Perforated Metal Seats on Grass	Record	L	Monitor security of the ground fixing of the seat near to the cradle seat swing. L Recommend grounds maintenance as required to reduce slip / trip hazards at areas of mud and ground erosion.						
Litter Bin	Broxap		Satisfactory condition.						
Metal Bow Top Fence	unknown		Satisfactory condition.						
Single Leaf Gate	Wicksteed 2017	L	Generally satisfactory, but recommend grounds maintenance as required to reduce slip / trip hazards at areas of ground erosion and exposed concrete. The gate is not self-closing.						
  Wicksteed Leisure Ltd Digby St., Kethering Northants, NN16 8YJ Tel: 01536 517 028			<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY: - <b>A J Hayes</b> DATE: - <b>14.02.2018</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered		<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>See sheet 3</b>
Continues on next sheet...									

Certified Inspection Report for:		Contact:	Order No:	Site Address:	SHEET			
Woodmansey Parish Council Juniper Cottages, 1 Manor Barn, Millington York YO42 1TX		Judith Roberts Tel: 01759 307 423 / 07825 791 790 Email: woodmanseyclerk@lawks.co.uk	332209	Southwood Park Princess Way, Hull HU17 8PD Access via track next to No 9	3 of 3			
DESCRIPTION OF PRODUCT(S) INSPECTED	MAKER & YEAR	RISK RATING	INSPECTION COMMENTS	QTY.	PRODUCT CODE	DESCRIPTION OF PART(S) REQUIRED	UNIT PRICE	TOTAL
Double Gates	Wicksteed 2017		Satisfactory condition. Not self-closing. The gates were open at the time of the inspection.					
General		L	Recommend grounds maintenance as required to reduce trip hazards at the holes in the grass at the edges of the safety surfaces, in particular around the Multiplay unit.					
		L	All play equipment and surfaces would benefit from cleaning. The best method is to pressure wash with a mild detergent solution.					
		M	Access by dogs is not physically prevented and routine inspection should include monitoring and removal of animal faeces.					
		L	(Litter (animal droppings) order 1991 of The Environment Protection Act 1990 requires public walks and pleasure grounds to be free from animal faeces) The provision of a sign (pictogram) is recommended giving the following information: a) General emergency telephone number (999 or 112) b) Telephone number to contact maintenance personnel c) Name of the playground d) Address of the playground e) Other relevant local information, if applicable (ref: BS EN 1176-7:2008 clause 8.2.4)					
Outside Fenced Area Informal BMX Track	unknown		Satisfactory condition.					
Multi Sports Goal on Tarmac	Parkdale PPL		Satisfactory condition.					
Litter Bin	Wyborne 2014		Satisfactory condition.					
  Wicksteed Leisure Ltd Digby St., Kettering Northants, NN16 8YJ Tel: 01536 517 028 <a href="http://www.wicksteed.co.uk">www.wicksteed.co.uk</a>		<b>INDICATION OF RISK RATING ASSESSMENT</b> HIGH & MEDIUM HIGH RISK - See Introductory Notes MEDIUM RISK - See Introductory Notes VERY LOW & LOW RISK - See Introductory Notes		INSPECTED BY: - <b>A J Hayes</b> DATE: - <b>14. 02. 2018</b>		PARTS SUB TOTAL BALANCE C / FORWARD PARTS TOTAL EXC. CARRIAGE & VAT. (E&O.E.) LABOUR TO FIT PARTS * Based on all works ordered TOTAL COST OF WORKS, EXC. VAT		<b>£0.00</b> <b>£0.00</b> <b>£0.00</b> <b>£0.00</b>
 <p>A variety of signs are available from Wicksteed Sales Dept</p>								